

Order-No.: DD+DIS119.00E

April 2000



1 Piece T508K MA1

Field Service Bulletin Nr. 9 for ADC Solo Type 5155

Please file this document in section 13 of your Technical Documentation.

Suction cups don't release IP

Classification			When?		
Safety relevant	Reliability	New function	Immediately	Next service	As required
	X				X

Problem

Transportation of Image Plate (IP) does not work properly. The IP remains at the suction cups because there is not sufficient air flow to resolve the vacuum.

Error message

22481: "Timeout of stepper drive opener"

Reason

Dust protection of solenoid valve has not been removed.

Solution

Remove dust protection.

Instructions

1. Open the right side panel.
2. Examine the solenoid valve of the vacuum pump in the IP-transport unit.

3. If the dust protection (arrow) is still on the solenoid valve, use a firm solid tool (e.g. screwdriver) to remove the plastic plug from the solenoid valve of the vacuum pump.



The dust protection can be removed permanently. It is not needed during operation.

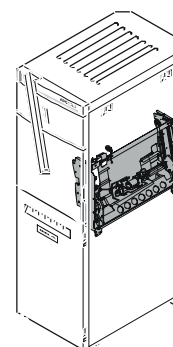


Figure 1

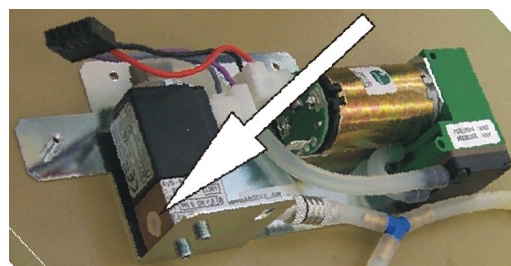


Figure 2